


GLP Firmware Change Log

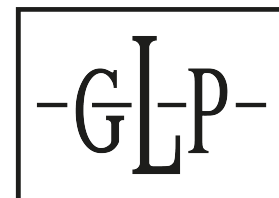

GLP Wild Wash 12 Firmware Log V0.4.2 - 4 August 2026 Rev5

Below you will find the history of all fixture firmware versions since the release of the device. Please note the respective information on functional changes, extensions, optimizations, etc. Even if it is our goal to develop firmware updates without relevant performance changes, it can always happen that optimizations or bug fixes can affect the device performance. Please read the note on "INFO" as a matter of urgency.

We strongly advise that firmware updates be carried out on individual replacement devices first. Likewise, updates should never be carried out shortly before an important use of the device. If in doubt, speak to your GLP Service Team.

04 Aug 2026 / Main changes from version 0.3.3 to 0.4.2

The iQ.Service app is mandatory for the update.

FEATURES	- Added Pan endless rotation. Fixtures that are on version 0.3.3 need to get a hardware rework from GLP. But they do work with version 0.4.2 - on the new dmx table. Please contact your local supplier for further information - improved dimming
BUG FIXES	n/a
UPDATE PROCESS	If you are updateing from version 0.3.3 to version 0.3.2, only the main firmware version has to be updated. This can be done via iQ.Service app > iQ.Mesh or via iQ.Service app > iQ.Tool via iQ.Tool you can daisy chain fixtures via DMX / XLR. For a faster mass update. Once the main software is transfered and the app has finished, the fixtures could might need another 1 or 2 minutes for internal firmware distribution. Also an error can show up during a calibration upload. i If an iQ.Mesh update is needed, and you are connected via iQ.Tools just set the input protocol to iQ.Mesh after the main firmware upload. You can do this easily via the iQ.Service Tools (upper right toolbox) > RDM Manager > Set to iQ.Mesh. Once set to iQ.Mesh you have to leave the iQ.Tool (upper left: <) Scan for fixtures and update all fixtures to the latest iQ.Mesh version 6.0.35, or later After this a creative config update could follow. If you want to work with the fixtures via DMX afterwards, do not forget to change the input now back to DMX. RDM Manager > Set to DMX.
Show critical update	! This update is show critical as the dmx table changes. Each mode gets another two channels for controlling the pan rotation. After the update, fixtures can be on factory settings.
INFO	Wild Wash 12 Version 0.4.2 ; Bootloader V3.4.1 iQ.Service Version 2.10.4, or later. iQ.Mesh Version 6.0.35 or later Please make sure that no other DMX receivers or consoles are active on the line. Please power cycle the fixtures after the update .

GLP Firmware Change Log

GLP Wild Wash 12 Firmware Log V0.4.2 - 4 August 2026 Rev5




08 Jul 2026 / Main changes from version 0.3.2 to 0.3.3

The iQ.Service app is mandatory for the update.

FEATURES	• n/a
BUG FIXES	• improved the zoom reset
UPDATE PROCESS	If you are updateing from version 0.3.2 to version 0.3.3, only the main firmware version has to be updated. This can be done via iQ.Service app > iQ.Mesh or via iQ.Service app > iQ.Tool via iQ.Tool you can daisy chain fixtures via DMX / XLR. For a faster mass update. Once the main software is transfered and the app has finished, the fixtures could might need another 1 or 2 minutes for internal firmware distribution. Also an error can show up during a calibration upload. i If an iQ.Mesh update is needed, and you are connected via iQ.Tools just set the input protocol to iQ.Mesh after the main firmware upload. You can do this easily via the iQ.Service Tools (upper right toolbox) > RDM Manager > Set to iQ.Mesh. Once set to iQ.Mesh you have to leave the iQ.Tool (upper left: <) Scan for fixtures and update all fixtures to the latest iQ.Mesh version 6.0.35, or later After this a creative config update could follow. If you want to work with the fixtures via DMX afterwards, do not forget to change the input now back to DMX. RDM Manager > Set to DMX.
	This update is show critical as pan and tilt speed and acceleration has been increased for the X5 IP Maxx. It is critical for the complete X5 series because of the magenta green shift change and bugs in CTC and Tungsten channels have benn solved. After the update, fixtures can be on factory settings.
INFO	Wild Wash 12 Version 0.3.3 ; Bootloader V3.4.1 iQ.Service Version 2.10.4, or later. iQ.Mesh Version 6.0.35 or later Please make sure that no other DMX receivers or consoles are active on the line. Please power cycle the fixtures after the update .

GLP Firmware Change Log

GLP Wild Wash 12 Firmware Log V0.4.2 - 4 August 2026 Rev5

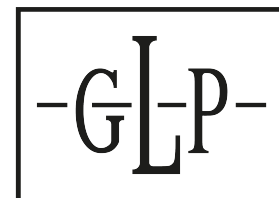

16 Apr 2026 / **First Release Version 0.3.2 / BL 3.4.1**

iQ.Service App and iQ.Tool is needed both for the update

FEATURES	• corrected tilt direction • increased movement speed to match X5 series better
BUG FIXES	• n/a
UPDATE PROCESS	1. Update the bootloader to V3.4.1 with iQ.Service and an iQ.Tool, daisy chained via DMX/XLR. The display will go off and could stay off for complete step 1 and step 2 . Please just wait the 5 minutes timer for internal bootloader firmware distribution, until the app asks you to proceed with step 2. 2. Main Software Update V0.3.2 via iQ.Service > iQ.Tool, daisy chained via DMX / XLR. Just proceed with step 2 and choose the firmware the app will show automatically. Once the main software is transferred and the app has finished, the fixtures could might need another 1 or 2 minutes for internal firmware distribution. Also an error can show up during a calibration upload. i If you loose power during the update, don´t worry you can start step 1 or 2 manually at any time. Just with the bootloader programmed on the fixture only, the fixture will not show up automatically in the app, and the display can stay off. For step 2, select in this case the upper right toolbox: > Fixture Update > Manual Update > Wild Wash 12 and then the desired firmware. It will take about 4 minutes. i If an iQ.Mesh update is needed, set the input protocol to iQ.Mesh after the main firmware upload. You can do this easily via the iQ.Service Tools (upper right toolbox) > RDM Manager > Set to iQ.Mesh. Once set to iQ.Mesh you have to leave the iQ.Tool (upper left: <) Scan for fixtures and update all fixtures to the latest iQ.Mesh version 5.6.3, or later After this a creative config update could follow. If you want to work with the fixtures via DMX afterwards, do not forget to change the input now back to DMX. RDM Manager > Set to DMX.
INFO	The update is show critical, the tilt direction has changed and the movement speed is increased Wild Wash 12 Version 0.3.2 ; Bootloader V3.4.1 iQ.Service Version 1.30.6, or later. iQ.Mesh Version 5.6.3 or later Please make sure that no other DMX receivers or consoles are active on the line